


Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

| Test ID | Test Type | Date Inspected | Company / Super. | Blower MH | Ground Condition | Notification Made? | Total Length |
|-----------|-----------|----------------|------------------|-------------|------------------|--------------------|--------------|
| S1028-292 | Smoke | 9/10/2009 | ADS/TM | S11001006MH | Dry | Yes | 940.80 |

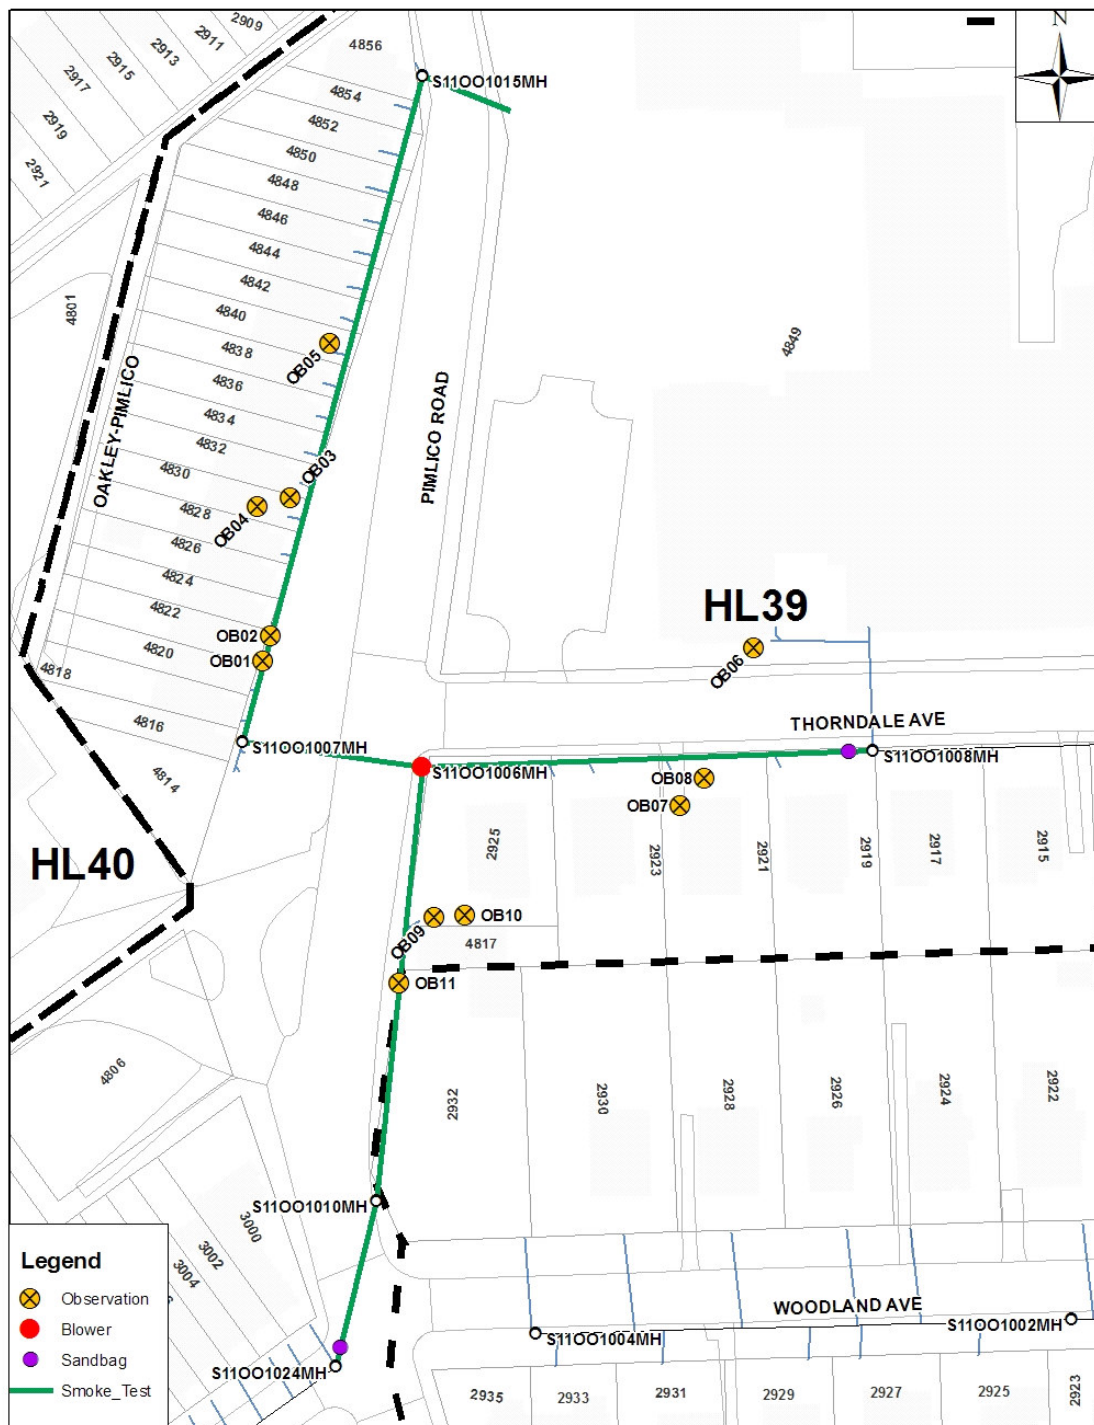

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

| Test ID | Test Type | Date Inspected | Company / Super. | Blower MH | Ground Condition | Notification Made? | Total Length |
|-----------|-----------|----------------|------------------|-------------|------------------|--------------------|--------------|
| S1028-292 | Smoke | 9/10/2009 | ADS/TM | S11001006MH | Dry | Yes | 940.80 |

Isolated Pipes

| Pipe ID | Upstream MH | Downstream MH | Length (ft) | Diameter (In) |
|-------------|-------------|---------------|-------------|---------------|
| S11001029G1 | S11001029DE | S11001015MH | 44.0358 | 8 |
| S11001015G1 | S11001015MH | S11001007MH | 320.864 | 8 |
| S11001007G1 | S11001007MH | S11001006MH | 84.5593 | 8 |
| S11001008G1 | S11001008MH | S11001006MH | 209.214 | 8 |
| S11001006G1 | S11001006MH | S11001010MH | 202.558 | 8 |
| S11001010G1 | S11001010MH | S11001024MH | 79.5644 | 8 |

Observations & Photos

Obs_ID S1028-292-OB01

Address 4822 Pimlico Rd

Status Private

Source Service Lateral

Location Yard - front

Nearest MH S11001007MH

Comments Smoke from service lateral in front yard. 4822 Pimlico Rd.



Picture \S1028-292-OB01-P01.jpg

Comments Front of house, 4822 Pimlico Rd.

Obs_ID S1028-292-OB02

Address 4824 Pimlico Rd

Status Private

Source Service Lateral

Location Yard - front

Nearest MH S11001007MH

Comments Smoke from service lateral in front yard. 4824 Pimlico Rd.



Picture \S1028-292-OB02-P01.jpg

Comments Front of house, 4824 Pimlico Rd.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

| Test ID | Test Type | Date Inspected | Company / Super. | Blower MH | Ground Condition | Notification Made? | Total Length |
|-----------|-----------|----------------|------------------|-------------|------------------|--------------------|--------------|
| S1028-292 | Smoke | 9/10/2009 | ADS/TM | S11001006MH | Dry | Yes | 940.80 |

Obs_ID S1028-292-OB03

Address 4830 Pimlico Rd

Status Private

Source Cleanout

Location Yard - front

Nearest MH S11001007MH

Comments Smoke from cleanout in front yard. 4830 Pimlico Rd.



Picture \S1028-292-OB03-P01.jpg

Comments Front of house, 4830 Pimlico Rd.

Obs_ID S1028-292-OB05

Address 4840 Pimlico Rd

Status Private

Source Service Lateral

Location Yard - front

Nearest MH S11001015MH

Comments Smoke from service lateral in front yard. 4840 Pimlico Rd.



Picture \S1028-292-OB05-P01.jpg

Comments Front of house, 4840 Pimlico Rd.

Obs_ID S1028-292-OB04

Address 4830 Pimlico Rd

Status Private

Source Service Lateral

Location Yard - front

Nearest MH S11001007MH

Comments Smoke from service lateral in front yard. 4830 Pimlico Rd.



Picture \S1028-292-OB04-P01.jpg

Comments Front of house, 4830 Pimlico Rd.

Obs_ID S1028-292-OB06

Address 4849 Pimlico Rd

Status Private

Source Service Lateral

Location Yard - side

Nearest MH S11001008MH

Comments Smoke from service lateral in side yard. 4849 Pimlico Rd.



Picture \S1028-292-OB06-P01.jpg

Comments Side of building, 4849 Pimlico Rd.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

| Test ID | Test Type | Date Inspected | Company / Super. | Blower MH | Ground Condition | Notification Made? | Total Length |
|-----------|-----------|----------------|------------------|-------------|------------------|--------------------|--------------|
| S1028-292 | Smoke | 9/10/2009 | ADS/TM | S11001006MH | Dry | Yes | 940.80 |

Obs_ID S1028-292-OB07

Address 2921 Thorndale Ave


Status Private

Source Service Lateral

Location Yard - front

Nearest MH S11001008MH

Comments Smoke from service lateral in front yard. 2921 Thorndale Ave.

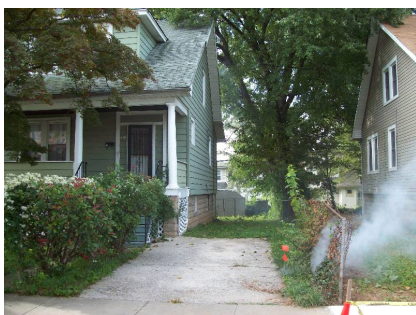

Picture \S1028-292-OB07-P01.jpg

Comments Front of house, 2921 Thorndale Ave.

Obs_ID S1028-292-OB09

Address 2925 Thorndale Ave

Status Private

Source Cleanout

Location Yard - side

Nearest MH S11001006MH

Comments Smoke from cleanout in side yard. 2925 Thorndale Ave.



Picture \S1028-292-OB09-P01.jpg

Comments Side of house, 2925 Thorndale Ave.

Obs_ID S1028-292-OB08

Address 2921 Thorndale Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S11001008MH

Comments Smoke from cleanout in front yard. 2921 Thorndale Ave.



Picture \S1028-292-OB08-P01.jpg

Comments Front of house, 2921 Thorndale Ave.

Obs_ID S1028-292-OB10

Address 2925 Thorndale Ave

Status Private

Source Service Lateral

Location Yard - side

Nearest MH S11001006MH

Comments Smoke from service lateral in side yard. 2925 Thorndale Ave.



Picture \S1028-292-OB10-P01.jpg

Comments Side of house, 2925 Thorndale Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

| Test ID | Test Type | Date Inspected | Company / Super. | Blower MH | Ground Condition | Notification Made? | Total Length |
|-----------|-----------|----------------|------------------|-------------|------------------|--------------------|--------------|
| S1028-292 | Smoke | 9/10/2009 | ADS/TM | S11001006MH | Dry | Yes | 940.80 |

Obs_ID S1028-292-OB11

Address 4817 Pimlico Rd

Status Public

Source Other

Location Sidewalk

Nearest MH S11001006MH

Comments Smoke from utility manhole in sidewalk. 4817 Pimlico Rd.



Picture \S1028-292-OB11-P01.jpg

Comments Front of building, 4817 Pimlico Rd.